


MultiMeter-PocketBox




Universal MultiMeter
in practical box format with
automatic range changeover

Rev.1214

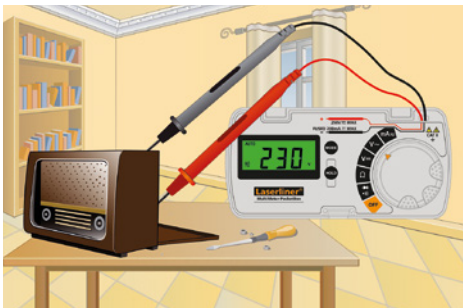

- Reliable, fast and precise **voltage, current and resistance measurement**
- **Automatic continuity tester** with acoustic signal
- **Diode test function** for determining integrity and polarity
- **Automatic function and range changeover** without reconnecting cables
- **CAT II - 250 V**
- **3 1/2 digit LCD**
- **Hold function**
- **Integrated test prods** in the box

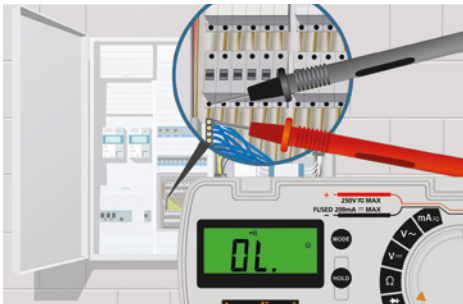

Large LC display

Easy-to-use rotary
function knob



Test prod holder

TECHNICAL DATA

VOLTAGE RANGE
V/DC:
 200 mV ... 200 V, ± (0,8% + 5 Digits)
 200 V ... 250 V, ± (1% + 5 Digits)
V/AC: (40 - 400 Hz)
 2 mV ... 200 V, ± (1% + 5 Digits)
 200 V ... 250 V, ± (1,2% + 5 Digits)

CURRENT RANGE
A/DC:
 20 mA ... 200 mA, ± (1,2% + 5 Digits)
A/AC: (40 - 400 Hz)
 20 mA ... 200 mA, ± (1,5% + 5 Digits)

RESISTANCE RANGE
 0 Ω ... 200 Ω, ± (1,2% + 5 Digits)
 200 Ω ... 200 kΩ, ± (1,0% + 5 Digits)
 200 kΩ ... 2 MΩ, ± (1,2% + 5 Digits)
 2 MΩ ... 20 MΩ, ± (1,5% + 5 Digits)

MAX. INPUT VOLTAGE
 250 V AC/DC

DIODE TEST open circuit voltage 1.5 V

CONTINUITY TEST
 Audible signal if the resistance is < 30 Ω

INPUT RESISTANCE
 > 10 MΩ (V DC, V AC)

POLARITY Sign for negative polarity

LCD bis 1999 (3 1/2 segments)

FUSE
 250 mA/250 V, Ø 5 mm x 20 mm

OVERVOLTAGE CAT II - 250 V

POLLUTION DEGREE 2

DEGREE OF PROTECTION IP 40

MAX. REL. HUMIDITY
 75% rH non-condensing

OPERATING TEMPERATURE
 0 °C ... 40 °C

POWER SUPPLY
 2 x LR44 1,5 V button cell

DIMENSIONS 113 x 56 x 23 mm

WEIGHT (incl. batteries) 101 g



MultiMeter-PocketBox
 + batteries

Packing dimension (W x H x D)
 107 x 234 x 52 mm

ARTICLE	ARTICLE NO	EAN-CODE	PU
MultiMeter-PocketBox	083.028A	4 021563 690053	5

